


Why do we often see lines in color match panels and not on the coated building panel?

The small parallel lines seen on lab prepared panels are the result of the application method used in the laboratory. (See Picture 1) To achieve a uniform thickness of coating in the laboratory, wire wrapped around metal rods is used to apply the coating. (See Picture 2) The amount of coating applied is controlled by the diameter of the wire used. The wire wound rods apply a wavy film that results in small parallel lines when the coating is drawn down the panel.

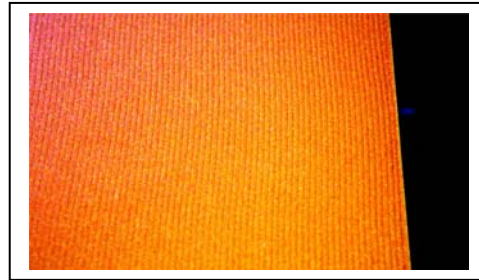

Picture 1: Parallel lines in lab prepared panel


In most of Valspar's Fluropon coatings these lines flow together to form a smooth film. Some pigments such as pearlescent or metallic used in the Fluropon Classic and Fluropon Classic II coatings restrict the flow and the lines remain in the coating after baking.



Picture 2: Drawdown rod

In the coil coating process the paint is applied to the metal strip by a polyurethane roll turning in the opposite direction to the metal. A reverse roll coater applies a smooth and uniform thickness of coating to the metal strip. (See Picture 3)

The reverse coil coated method used to coat metal coils for building panels cannot be economically duplicated in the laboratory. Similarly the small parallel lines in the lab prepared panel cannot be duplicated on a reverse roll coater.

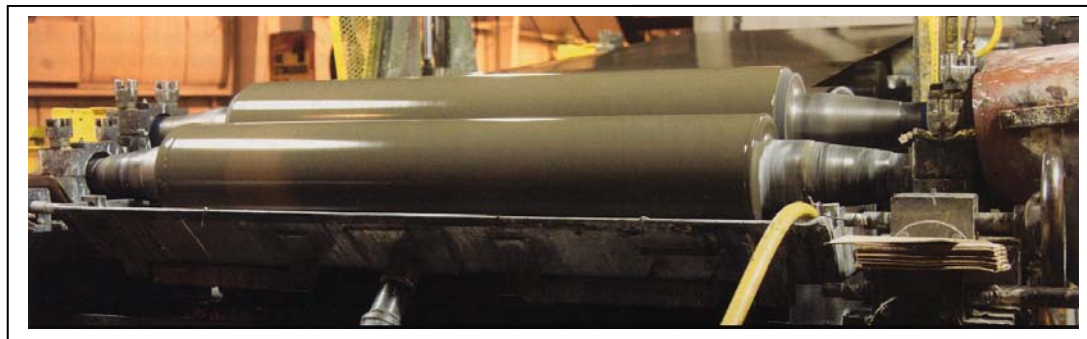

Picture 3: Reverse roll coater

KENTUCKY
347 Central Avenue
Bowling Green, KY USA 42101
Telephone: 270.843.4831
Facsimile: 270.746.6815

TEXAS
701 South Shiloh Road
Garland TX USA 75042
Telephone: 972.276.5181
Facsimile: 972.487.7245

ILLINOIS
901 North Greenwood Avenue
Kankakee, IL USA 60901
Telephone: 815.933.5561
Facsimile: 815.936.7811

C O I L C O A T I N G S

MEXICO
Avenue Central 223
Los Lermas
Guadalupe, N.L. Mexico 67190
Telephone: 52.81.8360.2020
Facsimile: 52.81.8360.5350

CHINA
No. 838 Jia Xin Road
Jiading District
Shanghai 201818
People's Republic of China
Telephone: 86.21.5990.1345

CANADA
645 Coronation Drive
West Hill, Ontario
Canada, M1E 4R6
Telephone: 416.284.1681
Facsimile: 416.284.7217

BRAZIL
Estrada dos Casa, 5050 – Portco B
09840-900 Sco Bernardo do Campo
Sao Bernardo do Campo
Telephone: 55.11.4358.9244
Facsimile: 55.11.4358.9228